

Moulding Installation

**Please
Read And
Follow All
Installation
Instructions
Carefully**

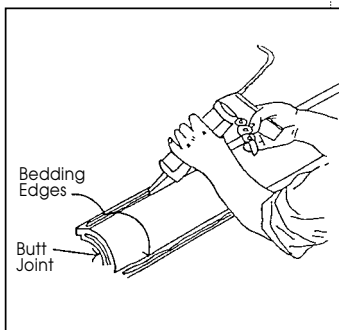


Figure 1

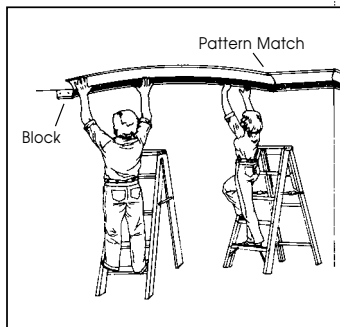


Figure 2

General

- Use only Focal Point AD3 Adhesive #33333.
- Focal Point mouldings have the same density and workability as white pine.
- Mouldings that have been stored in hot conditions should be allowed to cool down to normal temperatures before installation.
- Focal Point mouldings are factory primed.

1. Cutting

- Mark projection and depth on walls and ceilings. These dimensions can be found in the chart on the back of this sheet.
- Cut 45° compound miters for inside and outside corners (*do not cope inside corners*). Apply Focal Point Adhesive #33333 and fasten with trim screws or finish nails.
- Cut butt joints for all straight joints, apply AD3 Adhesive to both edges. (*do not use scarf or lap joints*).
- For large profiles (8" face or larger) apply 1/4" bead of AD3 Adhesive #33333 to the top and bottom bedding edges on the back side of moulding (see figure 1) or apply AD3 Adhesive #33333 to inside wall and ceiling marks.
- Cut mouldings 1/4" longer and spring into place. If necessary, screw a wooden block to the wall and spring moulding against the block. Screw or nail moulding into place then remove the block (see Figure 2).
- Screw or nail moulding every 16".
- Remove excess wet adhesive with mineral spirits.

2. Finishing

- Caulk mouldings to wall and ceiling using a paintable latex caulk.
- Fill screw or nail holes with vinyl spackle.
- Cover joints with vinyl spackle and lightly sand with fine grit paper.
- If factory primer is sanded off, apply vinyl spackle to area, lightly sand, and prime.
- Use a high-quality latex or oil-based paint.
- Do NOT use lacquer paints.

See Moulding Cut Guide for proper table and blade cut angles



3006 Anaconda Drive
Tarboro • North Carolina • 27886
p 800.662.5550 f 800.352.9049
www.focalpointap.com

Important Information

Use only Focal Point Adhesive.

Call your local dealer with any questions.